


6 CORE SCREEN
FROM SADDLE BOX


53 RED
54 YELLOW -X
55 YELLOW +X
61 BLACK
63 BLUE
DATUM

KNEE CONNECTION BOX

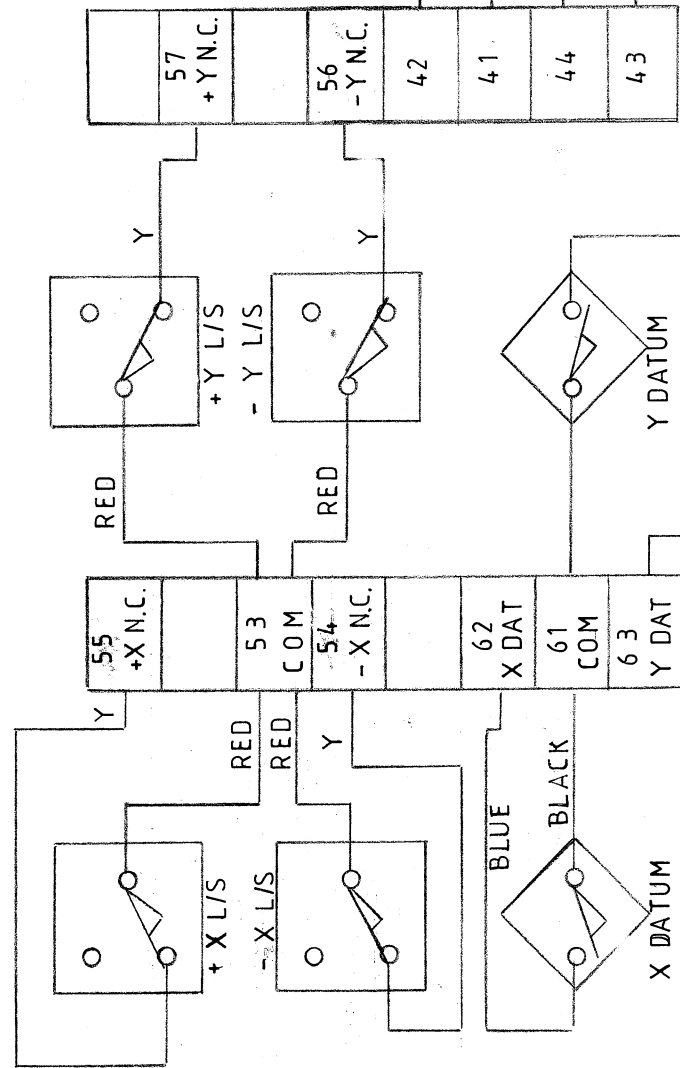


KNEE CONNECTION BOX
COLOUR CODE



55 ORANGE
53 GREEN
54 RED
62 VIOLET
61 BLACK
63 GREY
57 BLUE
56 YELLOW

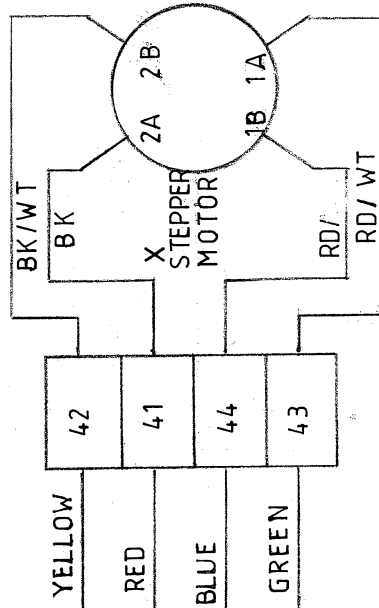


CONNECTOR 1
SOCKET

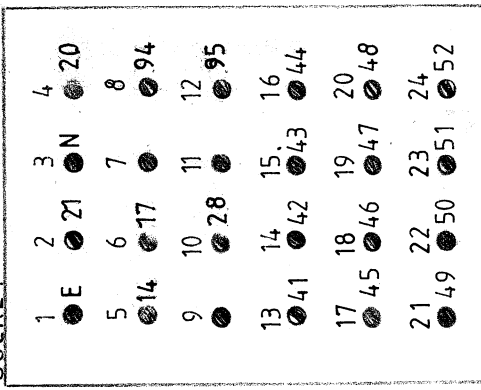

CONNECTOR 2
PLUG

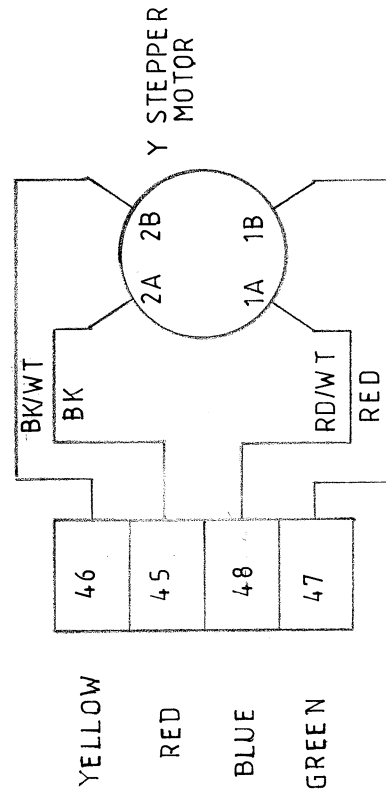
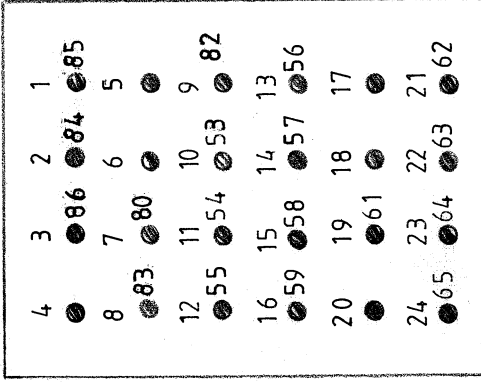


CONNECTIONS IN MILLING HEAD


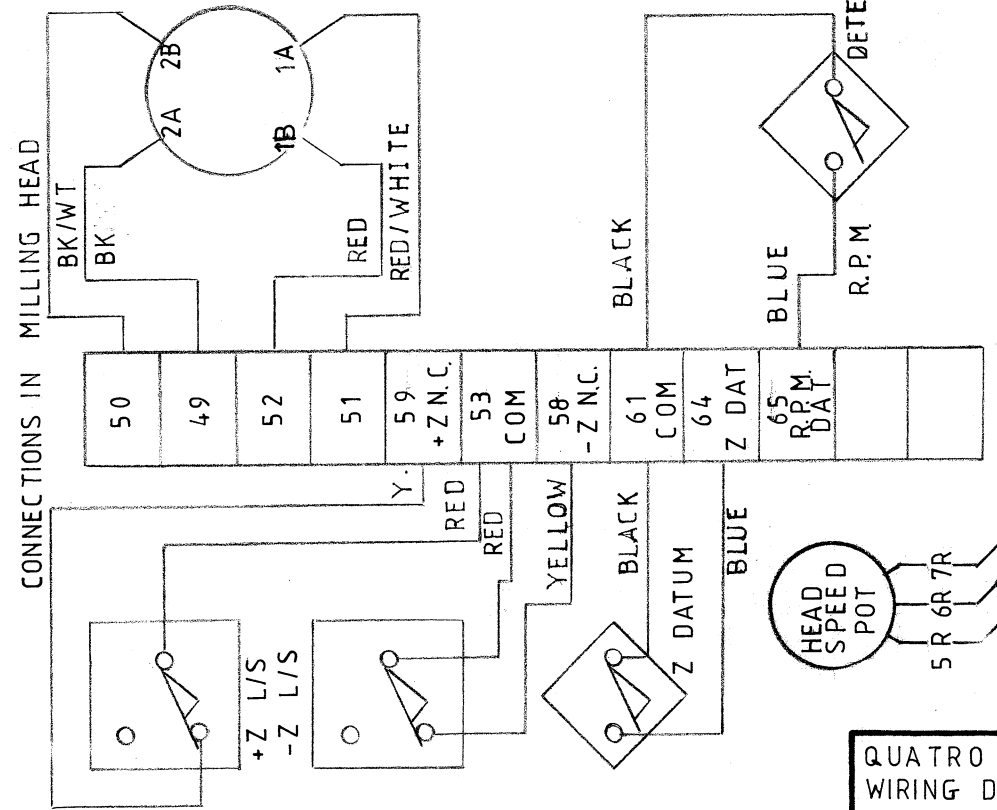


COLOUR CODE

50 YELLOW
49 RED
52 BLUE
51 GREEN
59 YELLOW
53 GREEN
58 RED
61 BLACK
64 BLUE
65 WHITE

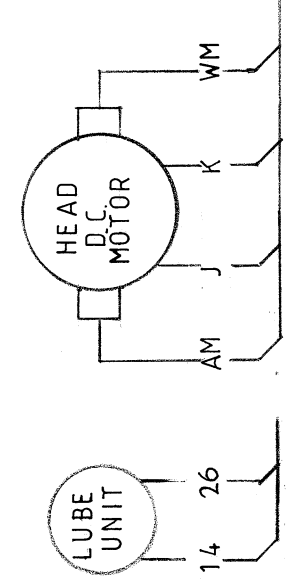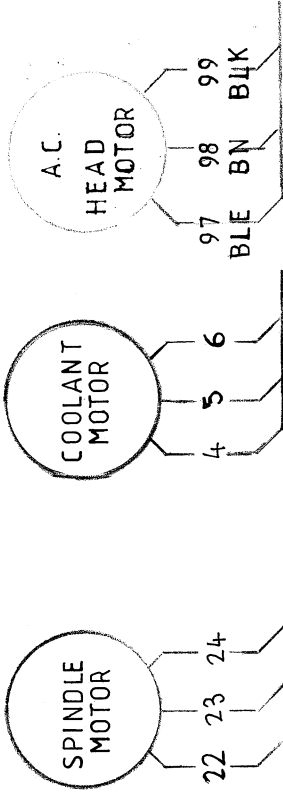





HEAD DRIVE LIMIT SWITCHES

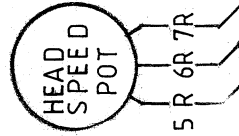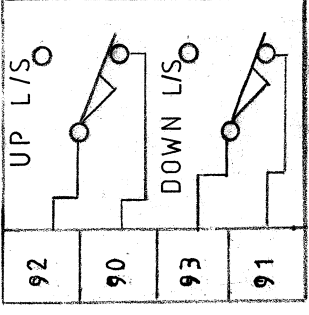

QUATRO MILL (VS)
WIRING DIAGRAM

SHEET No.
OF
CONT. ON
SHEET No.










D.C. DRIVE UNIT FOR HEAD

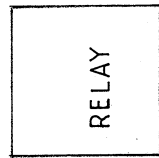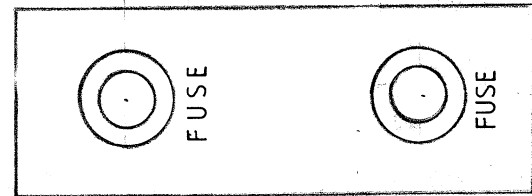

1R	3R	5R	6R	7R	8R	—	10R	—	—
----	----	----	----	----	----	---	-----	---	---

2	N	A	W	J	K
---	---	---	---	---	---

A	W	3R	5R	6R	7R	8R	10R	AM	WM	3R	5R	6R	7R			N	N	N
---	---	----	----	----	----	----	-----	----	----	----	----	----	----	--	--	---	---	---

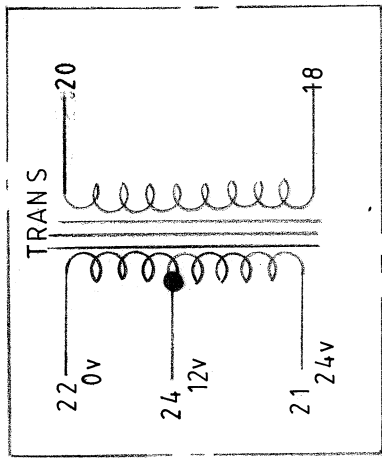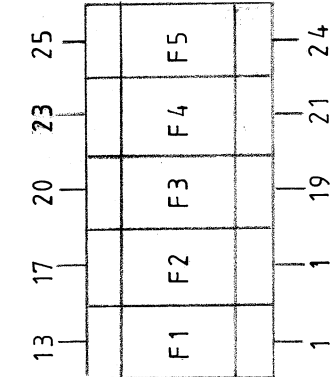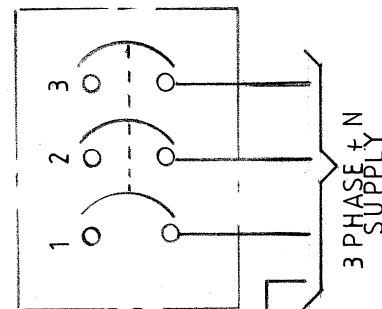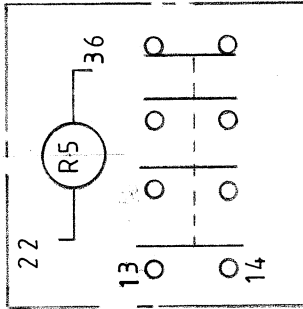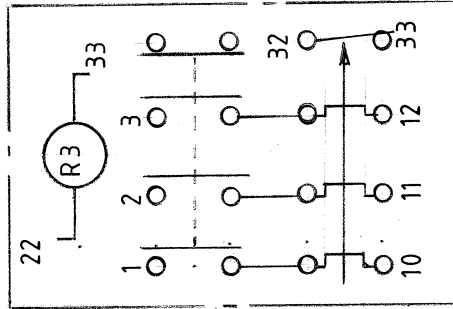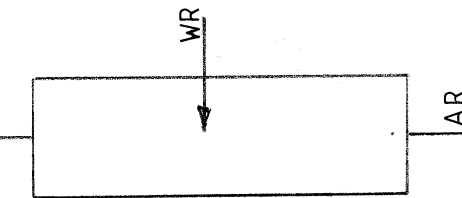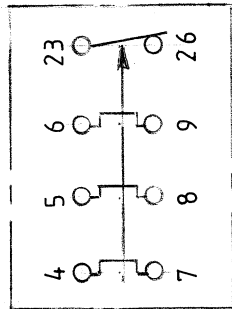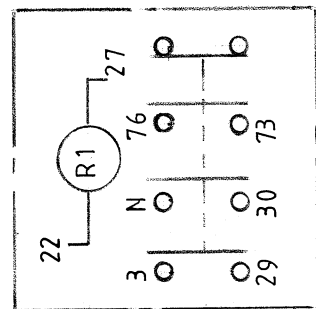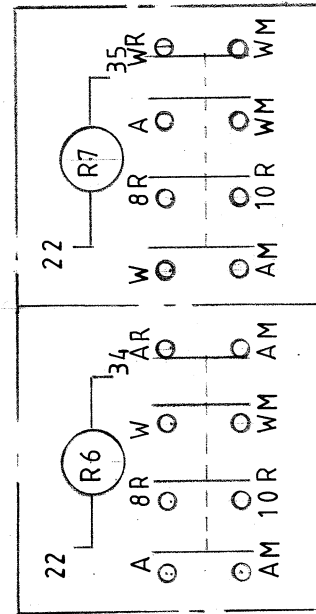


17	7	8	9	10	11	12	14	16	19	22	23	23	25	26	29	32	34	35	36
----	---	---	---	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----

FLA	FLB	FLC	ST	R	F	COM	0v	REF	CRF
	27	26	73	74	75	76	71	72	70


L1		N	R22	R24	T1	U	V	W
29		30		3	N	4	5	6

COMBIVERT 53 CONNECTIONS

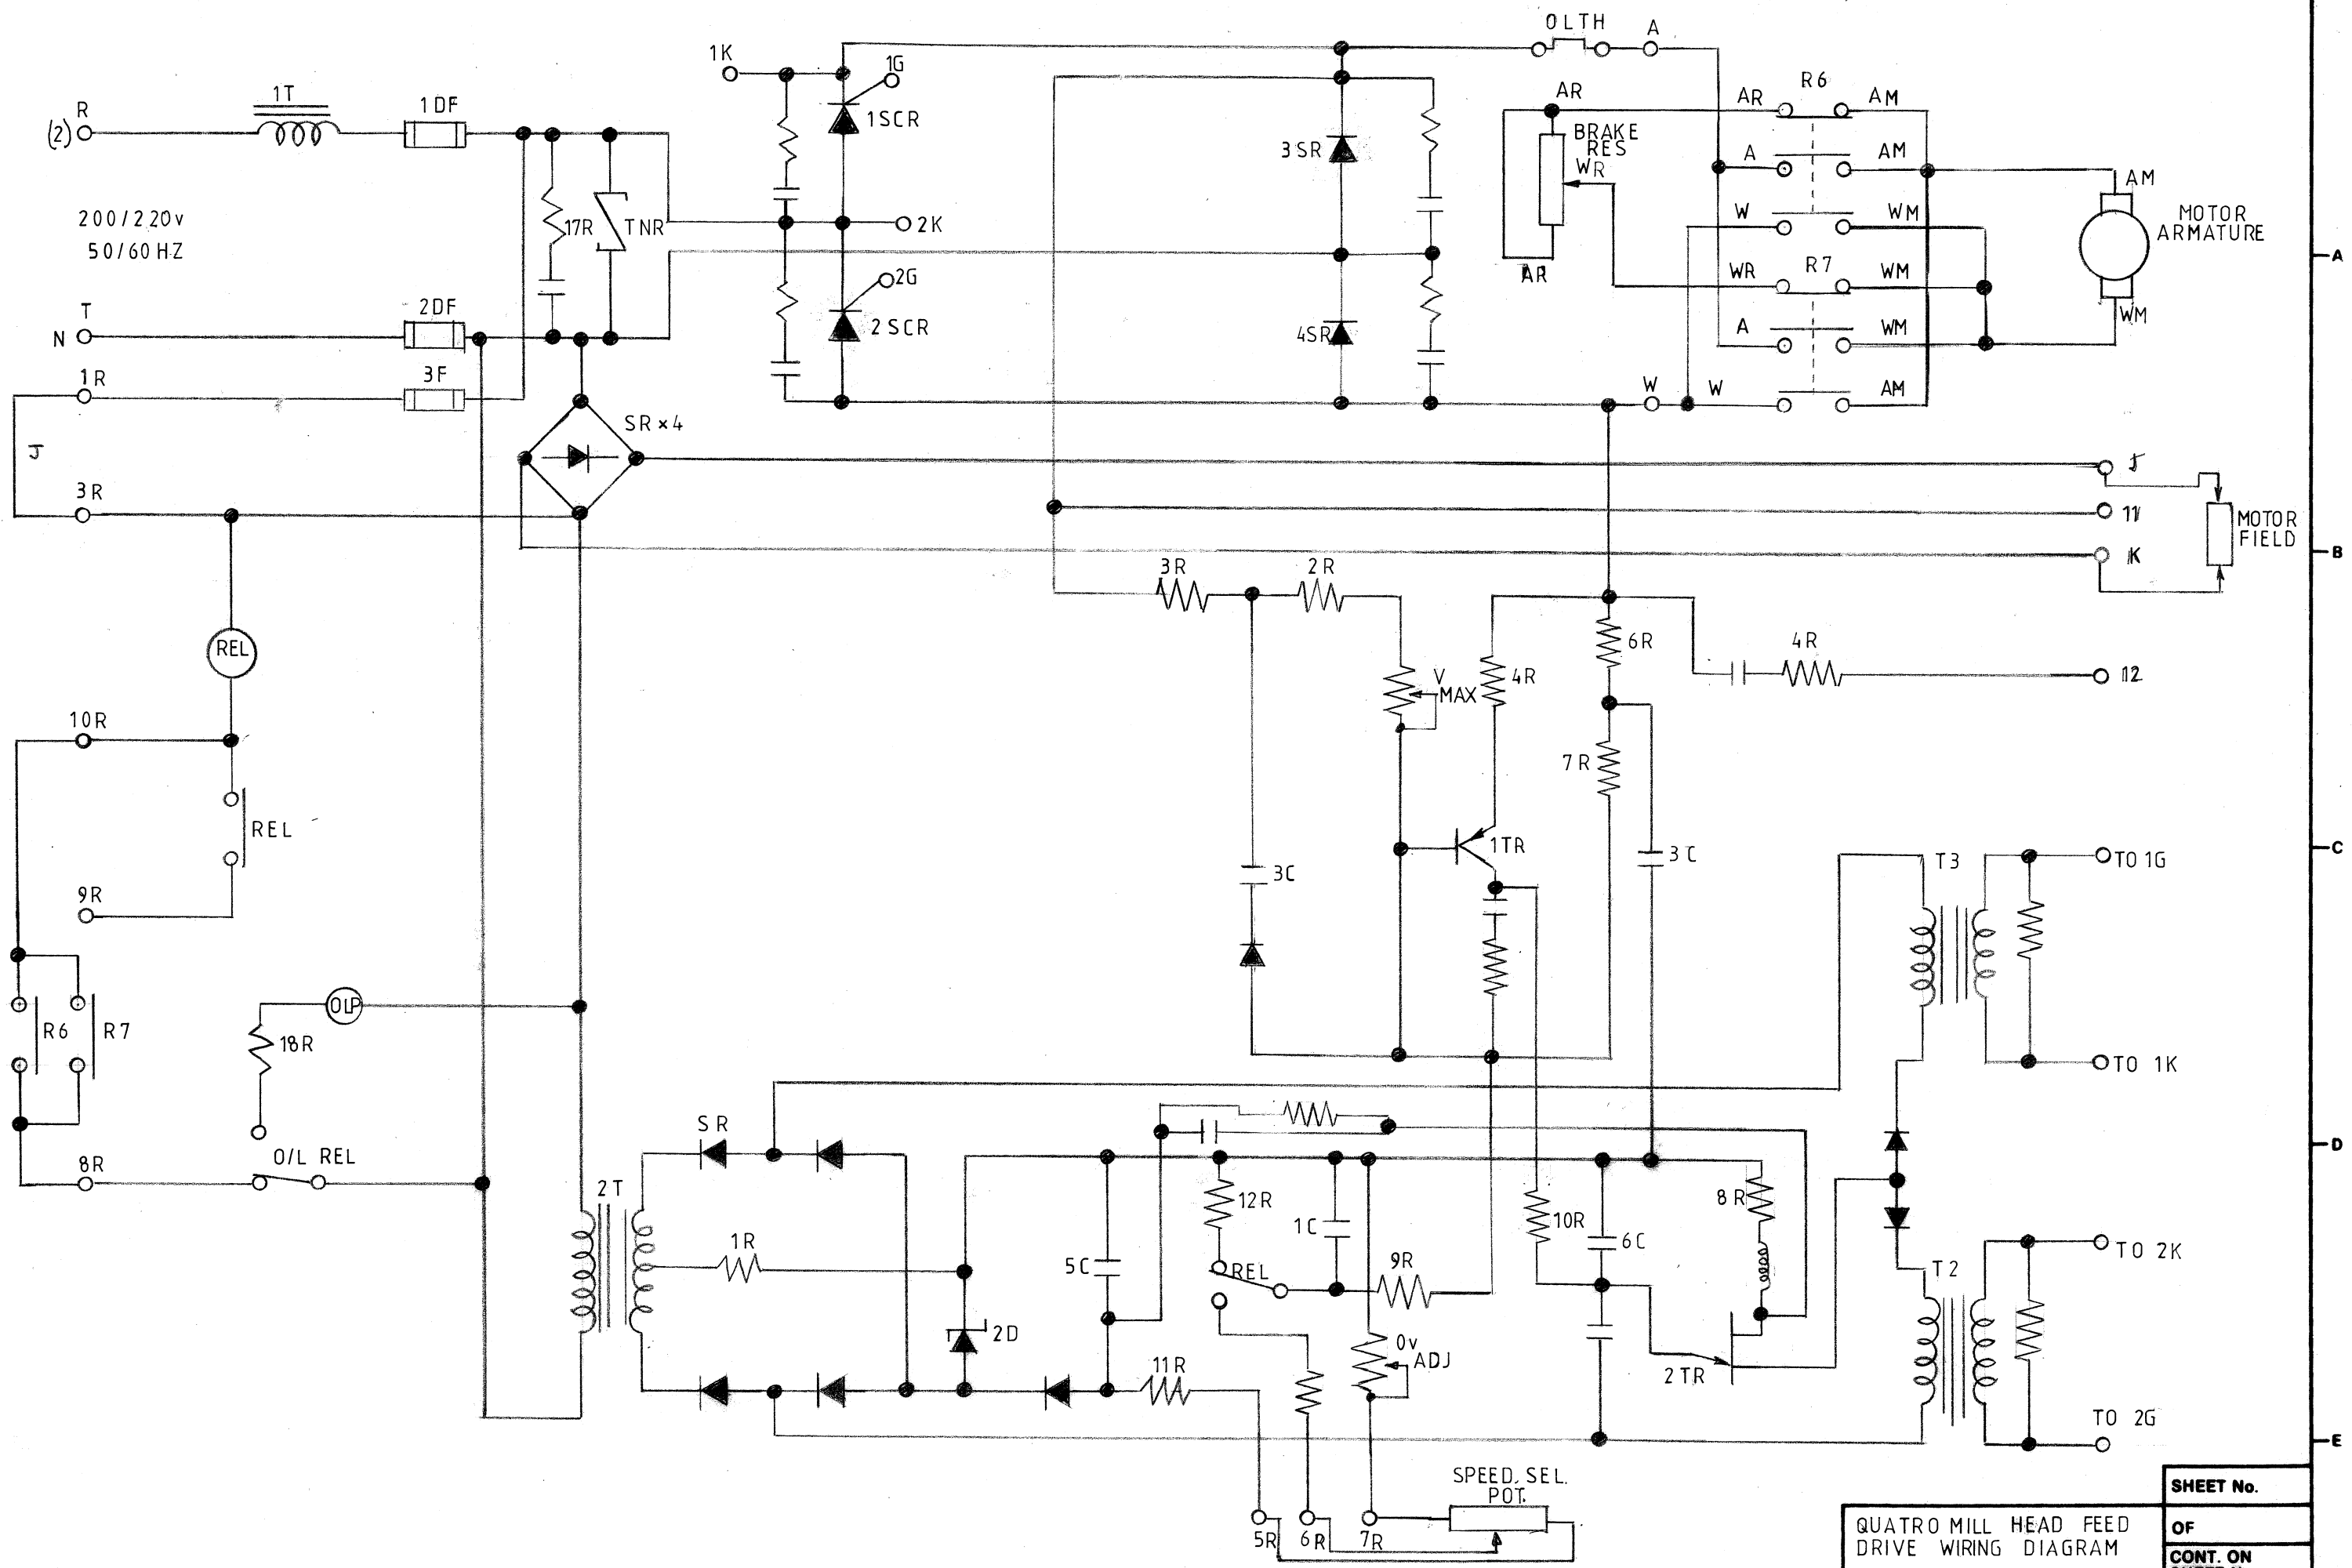


QUATRO MILL HEAD FEED
DRIVE WIRING DIAGRAM


SHEET No.
OF
CONT. ON SHEET No.

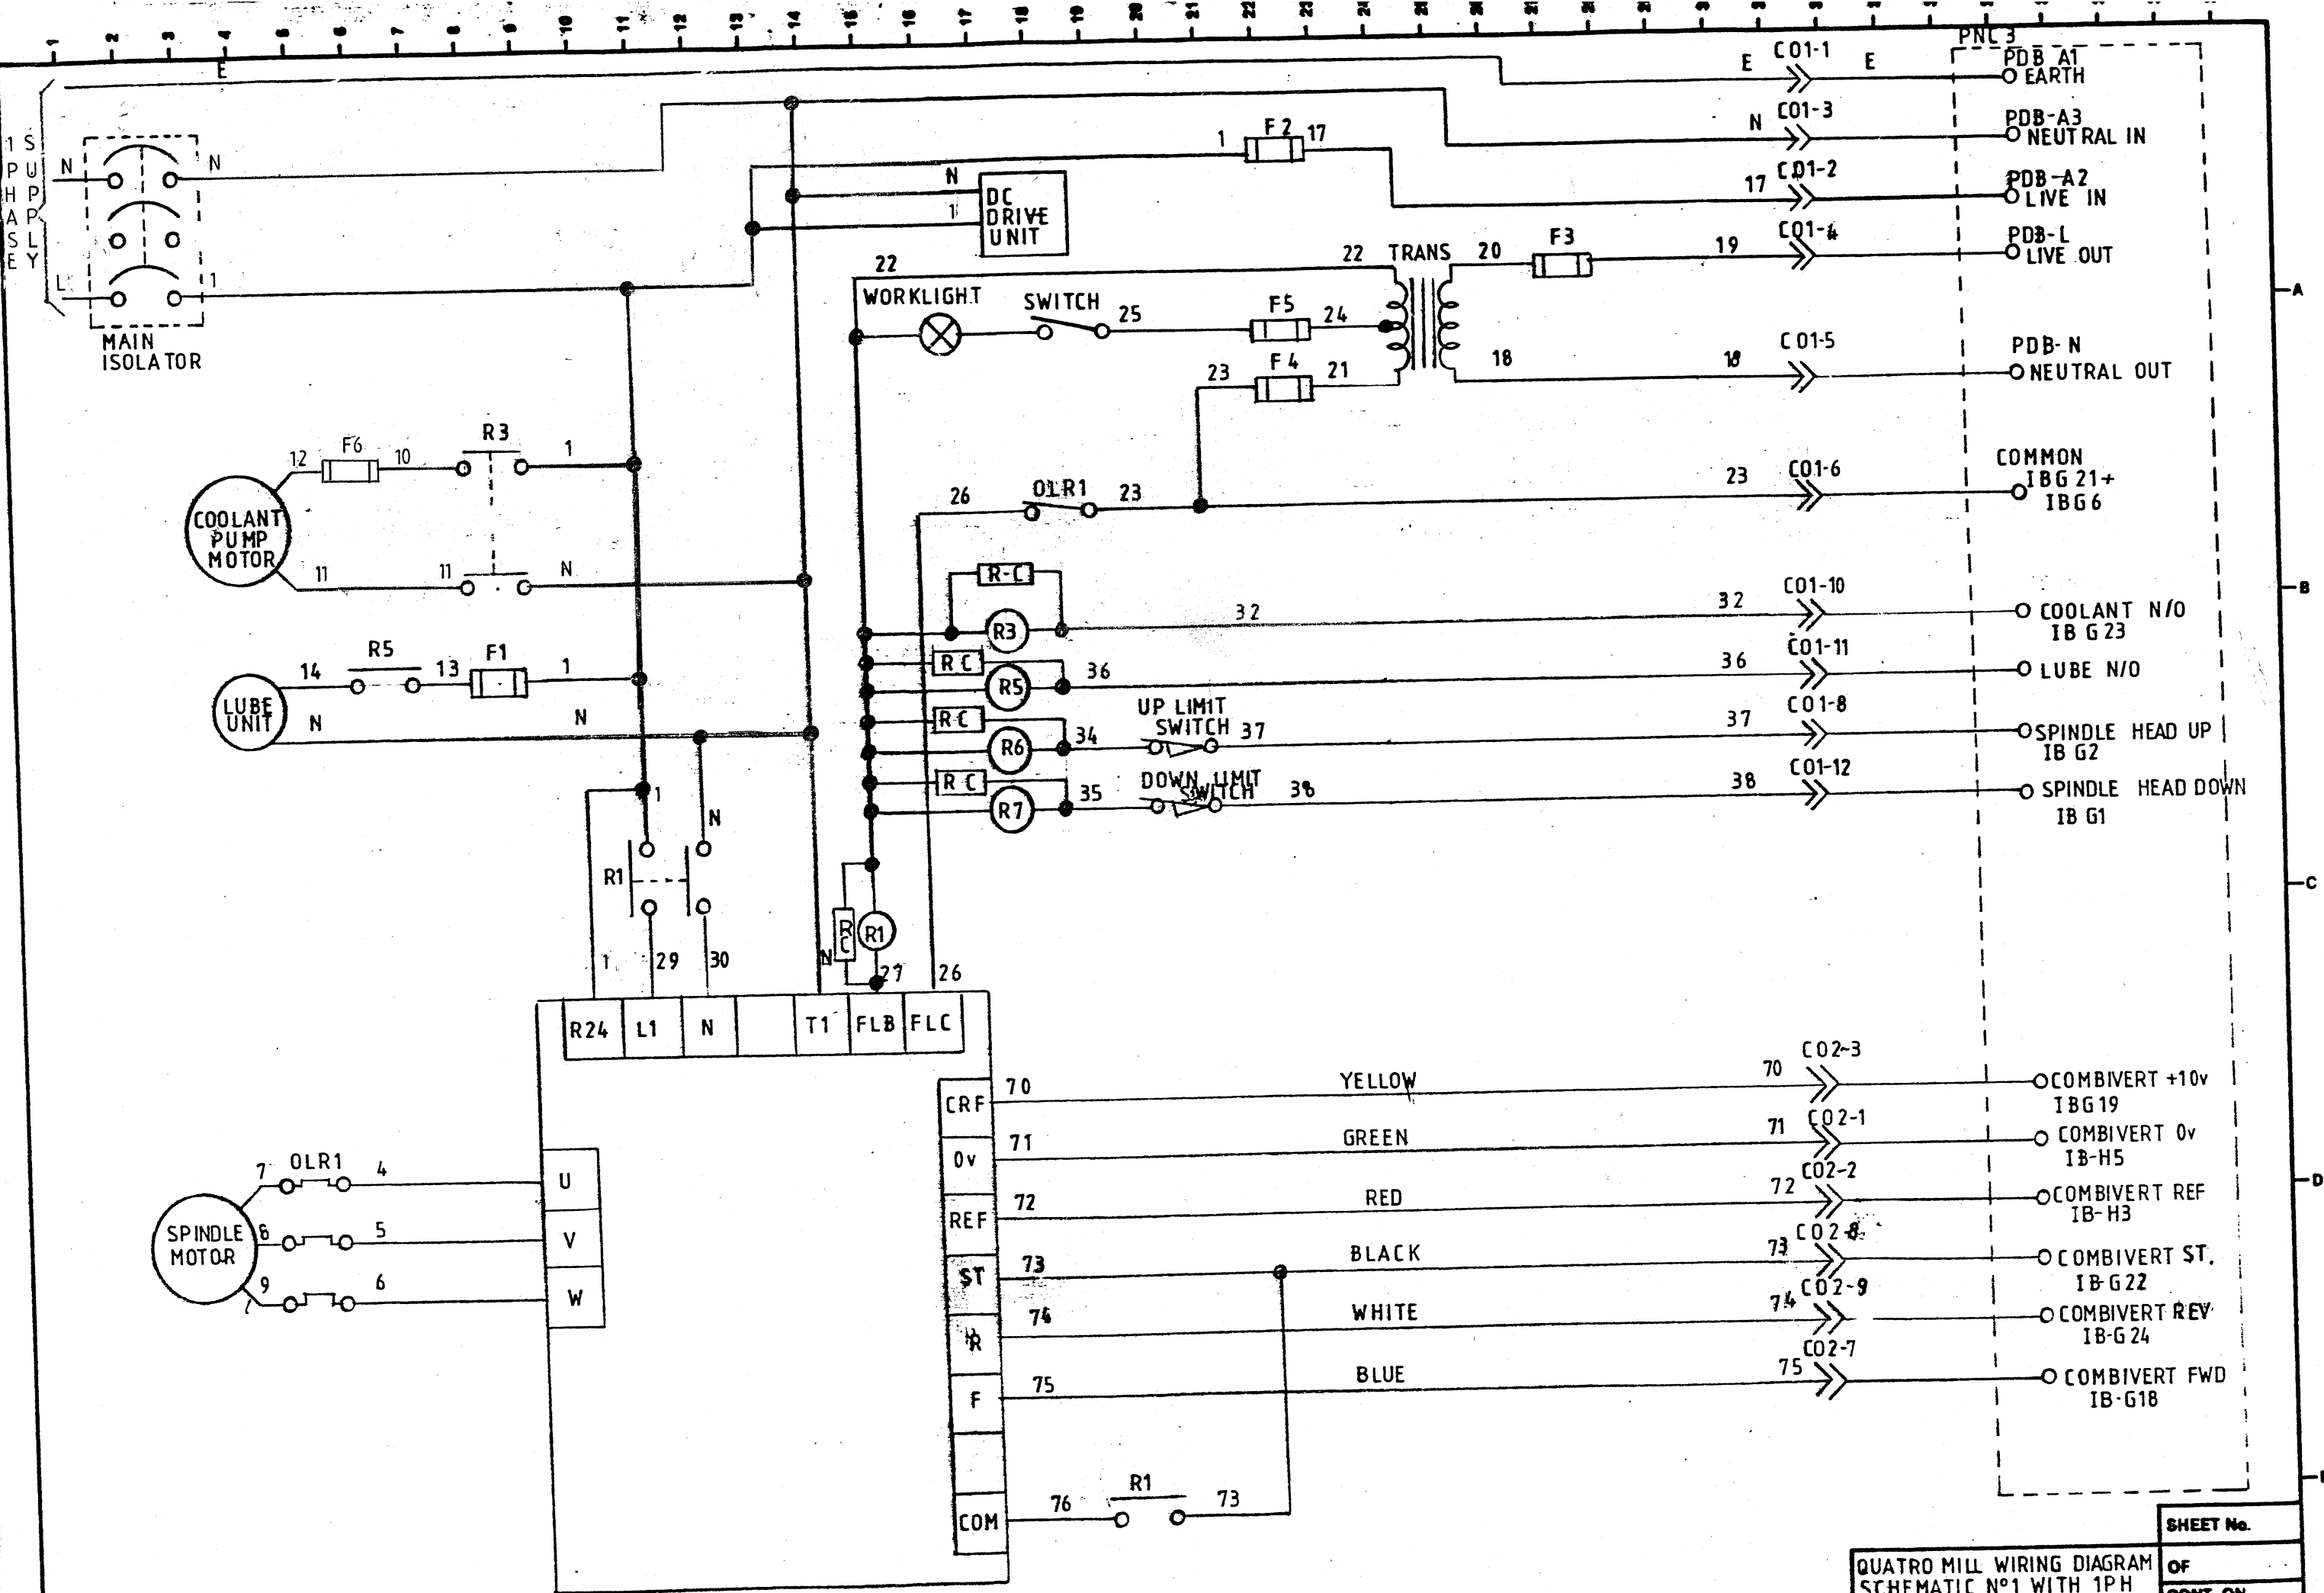

QUATRO MILL WIRING DIAGRAM
SCHEMATIC N°1 WITH 1PH
COMBIVERT 53 1PH SUPPLY

SHEET No.
OF
CONT. ON
SHEET No.

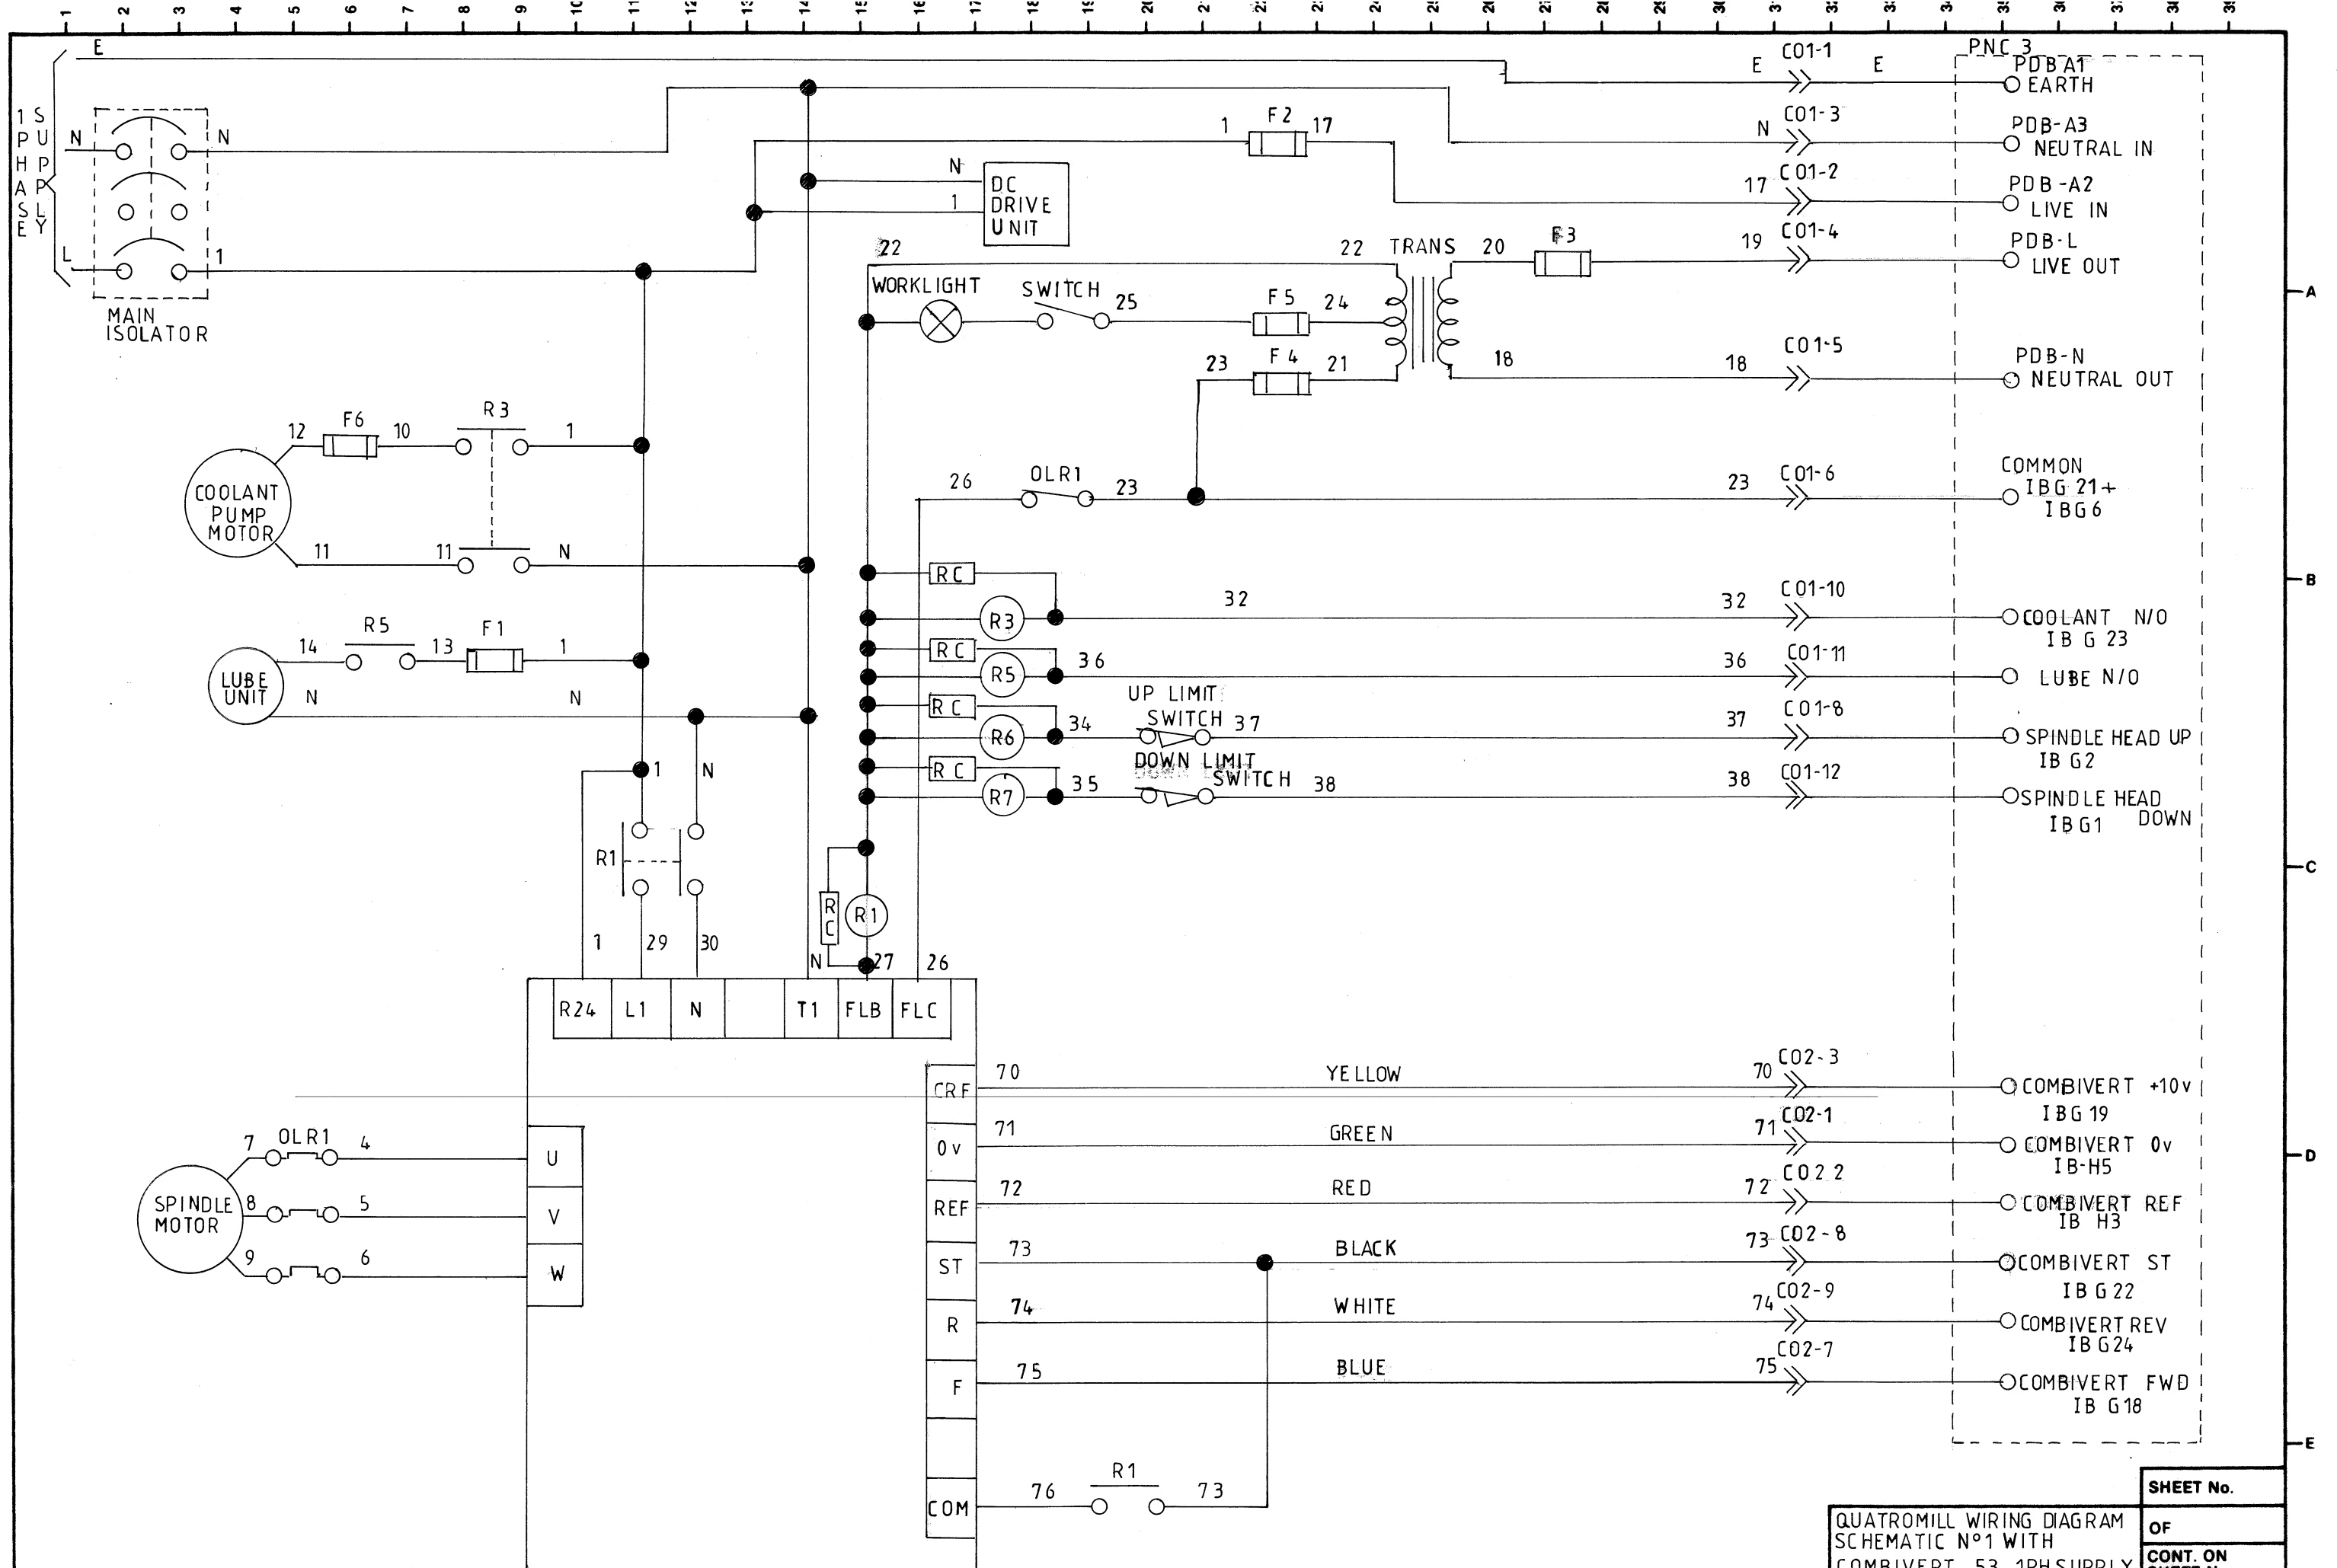

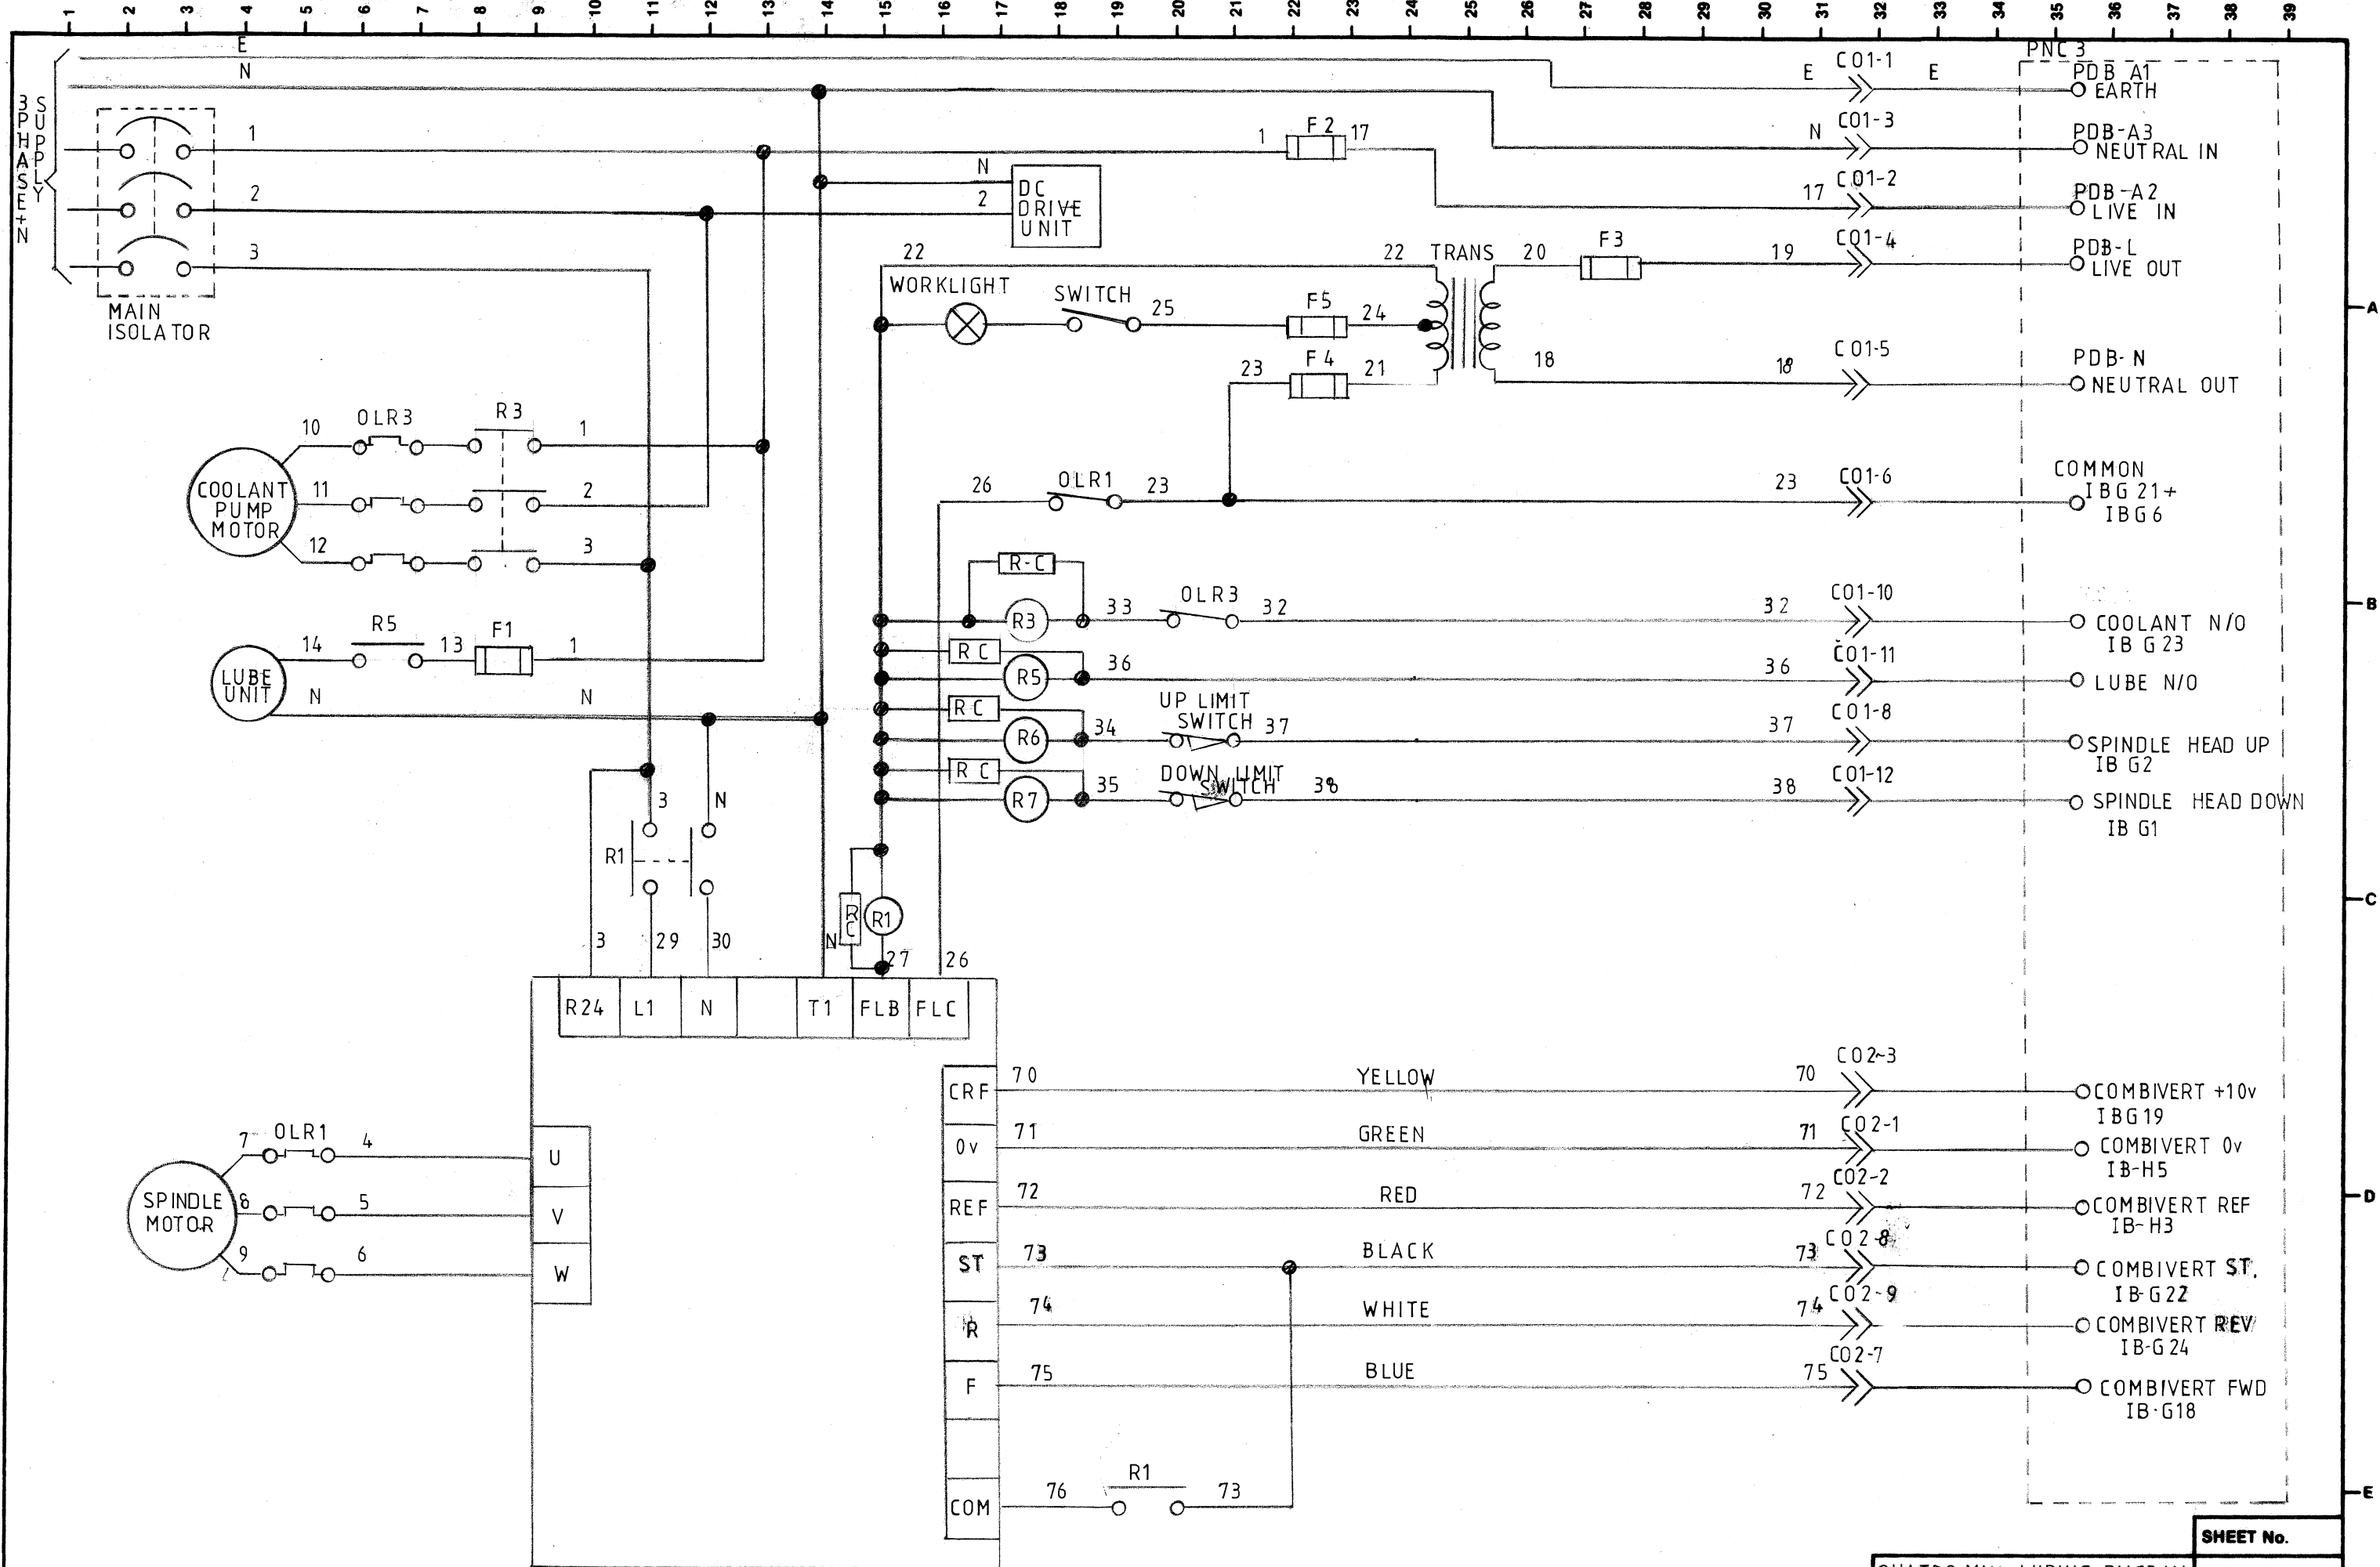

QUATRO MILL WIRING DIAGRAM
SCHEMATIC N°1 WITH 1PH
COMBIVERT 53

SHEET No.
OF
CONT. ON
SHEET No.

