



4 WAY
SPRAYMIST
CONNECTOR

PIN	WIRE
1	10
2	N
3	E
E	E


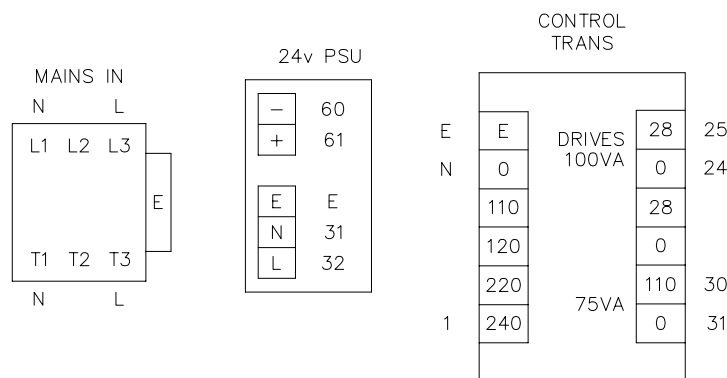


FUSES ON DINRAIL

F1	CONTROL TRANS	3.15 AMP
F2	SPINDLE DRIVE	10 AMP
F3	TOOLPOST BOARD AND SPRAYMIST	3.15 AMP
F4	110v AC CIRCUIT	3.15 AMP

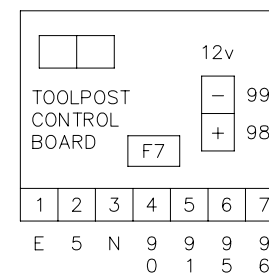

ADD LINK IF
SAFETY SWITCH
IS NOT FITTED

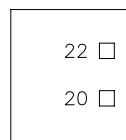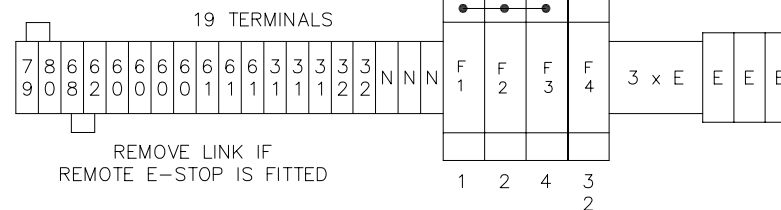

SPINDLE
CHOKE

FUSES ON COMPONENTS

F5	DENSTEP BOARD	6.3 AMP	(SEE SHEET 6)
F6	SPINDLE DRIVE	16 AMP	(SEE SHEET 7)
F7	TOOLPOST BOARD	500m AMP	

NOVATURN
RELAY WIRING
DETAILS

SHEET 3
NOVATURN
DENSTEP

DENFORD LIMITED BRIGHOUSE WEST YORKSHIRE

DRN BY A McHENRY

DATE 13-5-2003

NVT-D3H